





Schott-Durchführungen und Verlängerungen

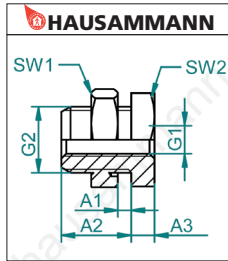

Schott - Durchführung mit durchgehendem Innengewinde

Messing vernickelt, Gewinde zylindrisch, aussen mit Kontermutter.

| Artikel | G1 | G2 | A1 | A2 | A3 | SW1 | SW2 | VP1 | VE | VP2 |
|---------|-------|-----------|-------|---------|--------|------|------|------|----|------|
| 38.960 | M5 | M10 x 1 | 7 mm | 10.5 mm | 3.5 mm | SW14 | SW14 | 2.00 | 25 | 1.40 |
| 38.961 | G 1/8 | M16 x 1.5 | 10 mm | 14 mm | 4 mm | SW22 | SW19 | 2.70 | 25 | 1.90 |
| 38.962 | G 1/4 | M20 x 1.5 | 16 mm | 21 mm | 4 mm | SW27 | SW24 | 4.20 | 25 | 3.10 |
| 38.963 | G 3/8 | M26 x 1.5 | 15 mm | 21 mm | 5 mm | SW32 | SW30 | 5.95 | 25 | 4.40 |
| 38.964 | G 1/2 | M28 x 1.5 | 21 mm | 27 mm | 6 mm | SW36 | SW32 | 7.60 | 10 | 5.70 |

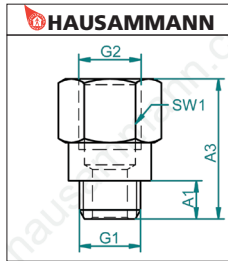

Innen-Aussengewinde Verlängerung

Gewinde zylindrisch, Material nach Angabe.

| Artikel | G1 | Material | G2 | A1 | A3 | SW1 | VP1 | VE | VP2 |
|----------|---------|--------------------|---------|-------|-------|------|-------|-----|------|
| 76.159 | M6 | Stahl | M10 x 1 | 5 mm | 24 mm | SW13 | 4.40 | 100 | 3.50 |
| 76.160 | M8 x 1 | Stahl | M10 x 1 | 5 mm | 18 mm | SW13 | 4.40 | 100 | 3.50 |
| 76.161 | M10 x 1 | Stahl | M10 x 1 | 5 mm | 18 mm | SW13 | 4.40 | 100 | 3.50 |
| 76.162 | G 1/8 | Stahl | M10 x 1 | 5 mm | 18 mm | SW13 | 4.40 | 100 | 3.50 |
| 38.671 | G 1/2 | Messing verchromt | G 1/2 | 10 mm | 50 mm | O | 8.15 | | |
| 38.672 | G 3/4 | Messing verchromt | G 3/4 | 12 mm | 50 mm | O | 11.55 | | |
| 38.673 | G 1 | Messing verchromt | G 1 | 13 mm | 50 mm | O | 17.80 | | |
| 43.904 | G 1/8 | Messing vernickelt | G 1/8 | 6 mm | 22 mm | SW14 | 1.35 | 25 | 1.00 |
| 43.905 | G 1/8 | Messing vernickelt | G 1/8 | 6 mm | 42 mm | SW14 | 2.40 | 25 | 1.90 |
| 43.906 | G 1/4 | Messing vernickelt | G 1/4 | 8 mm | 35 mm | SW13 | 2.40 | 25 | 1.90 |
| 43.906/L | G 1/4 | Messing vernickelt | G 1/4 | 8 mm | 51 mm | SW17 | 3.45 | 25 | 2.70 |